

# EXspect 271

## TECHNICAL INFORMATION

NIR Backscatter Sensor



All brand and product names are trademarks of the company:

EXNER PROCESS EQUIPMENT GmbH

## Imprint

Distributed by:

**Exner Process Equipment GmbH**

Carl-Metz-Str. 26

D-76275 Ettlingen

7 0

Contact:



[www.southforkinstruments.com](http://www.southforkinstruments.com)

Tel: 925 461 5059

Date of issue: 2023-06-20

As per: 25.01.2021

File: Technical information EXspect 271 210125

© 2020, Dipl.-Ing. [Graduate Engineer] Detlef Exner

All rights reserved, including the translation.

The reproduction of the content in these operating instructions is subject to prior written approval by EXNER PROCESS EQUIPMENT GMBH, ETTLINGEN.

All technical information, drawings, etc. is subject to the protection of copyright law.

Technical modifications reserved.

Printed on chlorine-free and acid-free pulp paper.

# Table of contents

<b>1</b>	<b>Technical data</b>	<b>4</b>
1.1	Standards	4
1.2	Specification	4
1.3	Dimensions	5
1.4	Environmental conditions	5
1.5	EXspect process conditions	5
1.6	Identification plate	6
<b>2</b>	<b>Product description</b>	<b>7</b>
2.1	EXspect 271 NIR backscatter sensor	7
2.2	Functions	8
2.3	Process integration	10
2.4	Checking and Adjustment	12
<b>3</b>	<b>Order structure for EXspect 271</b>	<b>14</b>
<b>4</b>	<b>Spare parts and accessories</b>	<b>15</b>
4.1	EXspect 271 accessories	15
4.2	EXspect 271 certificates	15
4.3	EXspect 271 factory inspection	15
4.4	EXspect 271 spare parts	16
4.5	EXspect 271 installation adapter	16
<b>5</b>	<b>Certificates and compliances</b>	<b>19</b>

# 1 Technical data

## 1.1 Standards

The following standards were applied when manufacturing the sensor:

- EN 61326-1: 2013-7
- EN 61326-2-3: 2013-7
- DIN/EN 27027 (ISO7027)

## 1.2 Specification

Sensor specifications	
Measurement range	0...100 %
Resolution	0.1 %
Accuracy	± 1.5 %
Reproducibility	≤ 1 % from final value
Wave length	850 nm
Light source	LED
Material	Stainless steel 1.4435 (316L)
Surface finish	Electropolished Ra <0.37 µm
Lens	Sapphire ball
Supply voltage	24 V DC
Output current	4...20 mA
Switch output	Can be set to NO or NC
Input contact	+24 V DC for adjustment (zeroing)
Cable connection	5 or 8-pin M12 plug
Cable length	2 m or 5 m
Process connection	G 1/2" for welding sockets with 35° cone

## 1.3 Dimensions

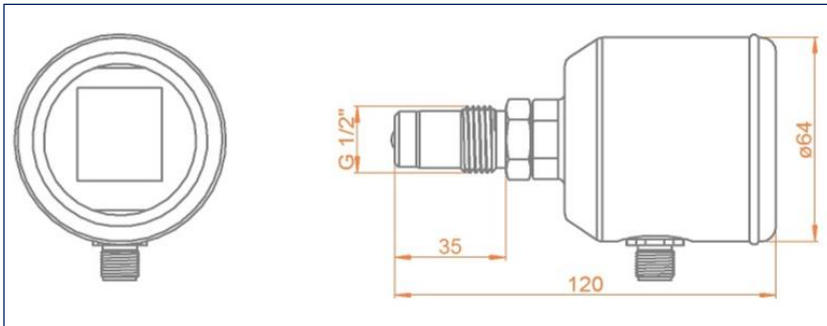


Fig. 1: Sensor dimensions

## 1.4 Environmental conditions

Ambient temperature -10...70°C

Transport and storage temperature -20...80°C

## 1.5 EXspect process conditions

Max. permissible pressure PS 20 bar

Max. permissible temperature TS: 90°C

Max permissible sterilisation temperature 141°C max. 2 hours

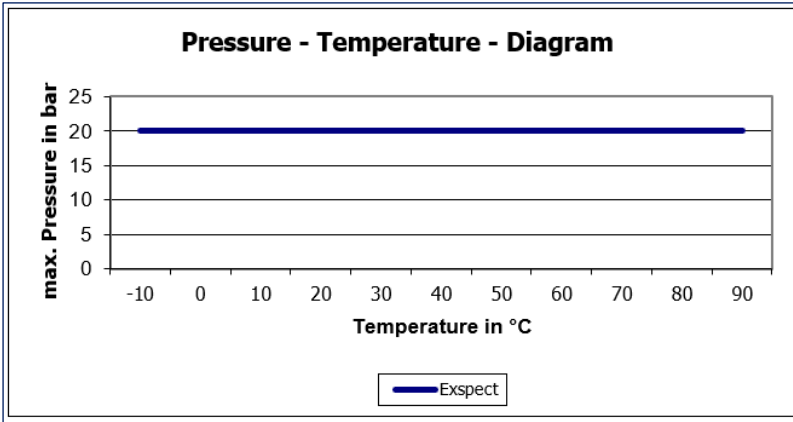


Fig. 2: EXspect pressure-temperature diagram

## 1.6 Identification plate



Fig. 3: Identification plate

In case of queries, please contact your dealer directly.

## 2 Product description

### 2.1 EXspect 271 NIR backscatter sensor



1	Housing cover
2	Touch display
3	M12 port
4	Pressure screw
5	Process connection
6	Sapphire lens (ball)

Fig. 4: NIR backscatter sensor

#### EXspect 271

The EXspect 271 NIR backscatter sensor enables monitoring of the turbidity of liquids for continuous monitoring of process results or safe indication of variations. It is particularly suitable for phase separation, separation control, filter monitoring and concentration measurement.

- Safe phase separation
- Quicker product changeovers
- Reduced waste water costs
- Filter monitoring
- Colour-independent concentration measurement
- Compact design with integrated booster and display
- Durable sapphire lens
- Hygienic design, CIP/SIP-compliant
- LED light source, guaranteed stable and long-lasting signal
- Integrated contact and analogue outlet
- Simple parameterisation
- Turbidity in % or a customer-specific unit

### Display

The current measurement value is shown on the display. The sensor can be configured using the touch display.

### Calibration input

The current measurement value can be set to 0 by briefly connecting a 24 V DC signal to the calibration input. With this, the transmitter can be adjusted to familiar measurement media (zeroed). The same is possible using the "Offset Val" menu function.

## 2.2 Functions

### Zeroing

Set the current measurement value to 0 using offset.

This is the same function as the calibration input via the external contact.

### Display switching

Defines which measurement value should be displayed:

- Turbidity
- Customer-defined unit (CDU)

The factory pre-set CDU value can only be changed or adjusted for sensors with the 8-pin M12 connector and the ECI-01 communication interface, as well as the EXpert 2.x software.

Independent of display toggling, the analogue output always provides a turbidity-dependent signal.

### Lower measuring range

Defines the 4 mA point for the output current. The range can be freely selected between 0 and 100 %.



## Upper measuring range

Defines the 20 mA point for the output current. The range can be freely selected between 0 and 100 %.

## Damping

Attenuates the turbidity measurement value by continuous averaging.

## Switch-off point

Defines the point at which the contact switch switched off. The range can be freely selected between 0...100 %.

## Switch-on point

Defines the point at which the contact switch switched on. The range can be freely selected between 0...100 %.

## Switch function

Defines the digital output function for the contact switch. You can choose between making contact and breaking contact.

## Switching delay

Defines the switching delay for the contact switch. You can choose freely from a range of 0...200 seconds.

## Language

Defines the display language.

## 2.3 Process integration

### Sensor


The EXspect 271 sensor is integrated directly into pipes or tanks with its G 1/2" connector, or by using corresponding adapters with the existing process connectors.



Fig. 5: Process integration

### Welding sockets

Installation using welding sockets guarantees hygienic process adaptation, which can be used with minimal dead space and free of elastomers. As this is a purely metal-sealed system, no other sealing materials, e.g. elastomers, may be used.


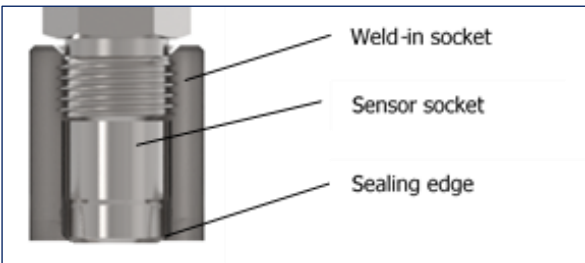


Please always use the weld-in plugs supplied as accessories so that the heat resulting from the welding process can be dissipated safely, and distortion of the drill hole is hindered effectively.



**Welding in tanks / pipes**

1. Drill a hole with the same external diameter as the weld-in plug (maximum tolerance is +0.2 mm)
2. Attach plugs at 4 evenly-spaced points (Fig. 1 below)
3. Screw the weld-in plugs in
4. Weld the parts between the 4 points (Fig. 2 below)

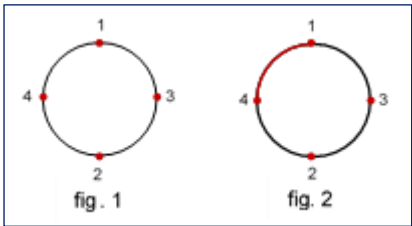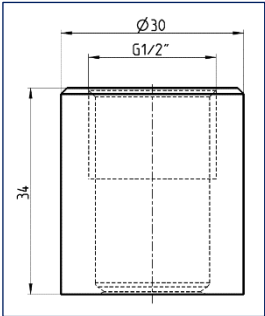

**Transmitter**

The transmitter is powered by a 24 V DC supply, has a freely programmable contact switch, and a 4...20 mA output for outputting measurement values. The measuring value can be set to 0 % via 24 V input.

**Pressure / Temperature**

The EXspect sensor can be used at a pressure of up to 20 bar and at a maximum process temperature of 141 °C.

To protect the LED which is used, it is switched off as of a temperature of 90 °C. Measurement is then no longer possible. The display shows the error message "Electricity LED".

After lowering the media temperature below 90 °C, the LED is reactivated and the error message disappears.

**NOTE**

Please note the pressure and temperature diagrams in → Chapter 3

---

### Installation position

In principle, the sensors can be used in any location. However, you must ensure that the pipe is completely filled, and that the sensor is not set up in a place where bubbles are formed due to high turbulence of the medium. You should also observe how easily the display can be read ensure good access and operability.

The following diagram shows the favoured locations for installing the sensor. As you can see, the sensor is better mounted on the side of the pipe.

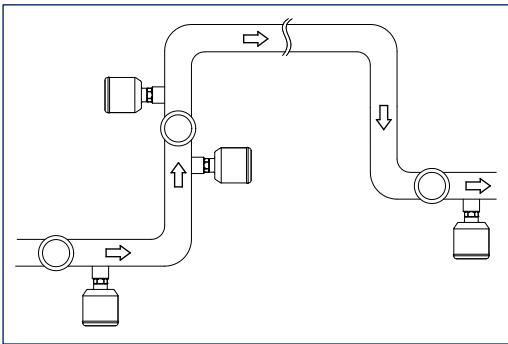


Fig. 6: Installation locations

## 2.4 Checking and Adjustment

Reference normals (EXcap 120) with varying backscattering values are available for checking and adjustment of the EXspect 271 sensor. If necessary, they can be attached to the sensor. To guarantee the inspection/adjustment is carried out without any errors, ensure that:

- The optical sensor unit is dry and clean

- The reference normal is placed precisely on the sensor
- The marking (arrow) for the standard is aligned with the sensor connector



Fig. 7: Reference normal with marking

### 3 Order structure for EXspect 271

EXspect 271 sensor						
	<b>Code</b>	<b>Measurement range</b>				
	A	0...100 % turbidity				
		<b>Code</b>	<b>Material</b>			
		4435	Stainless steel, 1.4435 (316L)			
		XXXX	Special version			
			<b>Code</b>	<b>Seal material (touching medium)</b>		
			MET	Metal sealing		
			XXX	Special version		
			<b>Code</b>	<b>Process connection</b>		
			G12	G1/2" thread		
			XXX	Special version		
				<b>Code</b>	<b>Interface</b>	
				AS	Analogue 4...20 mA / 5-pin M12	
				AD	Analogue 4...20 mA / can be parameterised digitally / 8-pin M12	
				XX	Special version	
					<b>Code</b>	<b>Display</b>
					1	with integrated display
					X	Special version
<b>EXspect 271</b>						<b>Order code</b>

## 4 Spare parts and accessories

The sensor serial number must always be quoted for spare parts and accessories orders.

### 4.1 EXspect 271 accessories

Description	Order number
2 m EXspect connector cable (M12 5-pin)	2-125-00-001
5 m EXspect connector cable (M12 5-pin)	2-125-00-002
2 m EXspect connector cable (M12 8-pin)	2-120-68-001
5 m EXspect connector cable (M12 8-pin)	2-120-68-002
PC software EXpert 2.x on a USB stick (for Windows)	2-120-69-003
Communication interface ECI-01 EXspect 271/231 for connecting to a PC via USB (connector cable M12 8-pin)	2-120-66-001

### 4.2 EXspect 271 certificates

Description	Order number
Certificate EN10204-2.2 for surface roughness (Ra <0.37 µm)	2-121-01-001
Certificate EN10204-3.1 for material	2-121-01-002

### 4.3 EXspect 271 factory inspection

Description	Order number
Factory recalibration for NIR sensors incl. certificate (proof of return)	2-999-00-013




### 4.4 EXspect 271 spare parts

Description	Order number
Operating and display unit	2-118-00-001
Housing cover with inspection glass	2-151-32-001

### 4.5 EXspect 271 installation adapter

Description	Drawing	Order number
Welding socket G 1/2" cylindrical		2-087-33-003
Brass welding aid G 1/2"		2-086-11-001
Varivent F process adapter DN 25-40		2-083-33-001

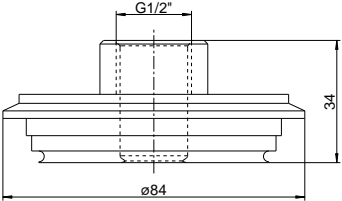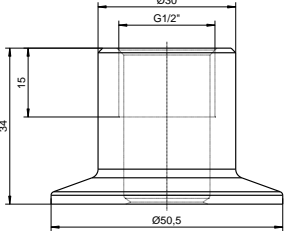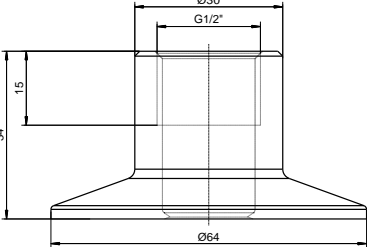


Description	Drawing	Order number
Varivent N DN 40-125 process adapter		2-083-33-002
Process adapter Tri-clamp 1 1/2"		2-083-33-005
Process adapter Tri-clamp 2"		2-083-33-006

### Weld-in pipe with adapter G 1/2"

Pipe material	1.4435
Adapter material	1.4404
Pressure range	0...10 bar

4 Spare parts and accessories

ØD	L	H	Order number
DN 25	100 mm	51.5 mm	2-083-33-007
DN 32	110 mm	54.0 mm	2-083-33-008
DN 40	120 mm	57.0 mm	2-083-33-009
DN 50	140 mm	63.5 mm	2-083-33-010
DN 65	160 mm	73.5 mm	2-083-33-011

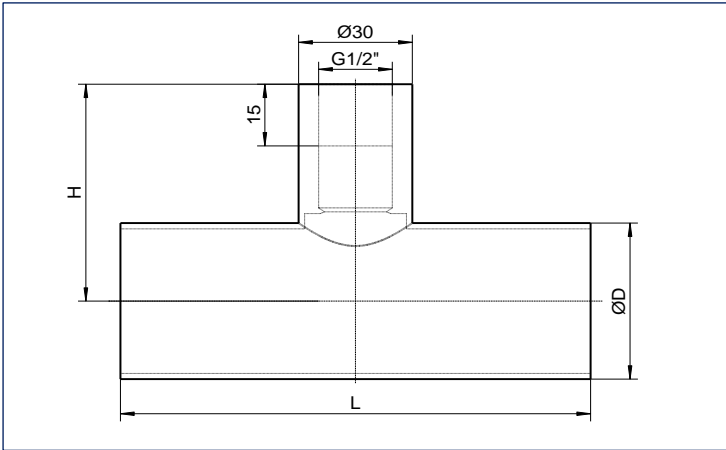

## 5 Certificates and compliances

### Declaration of conformity

for

### Turbidity sensor EXspect271

We declare under our sole responsibility that the product, to which this declaration relates is in conformity with the following standards and the normative documents:

EU- Directive	harmonized standards
EMV-Directive 2014/30/EU	DIN EN 61326-1:2013
Modul A	DIN EN 61326-2-3:2013

This declaration applies to all identical specimens of the product, which are manufactured according to the development-, design- and manufacturing drawings and descriptions, which are part of this declaration.

This declaration is given by the manufacturer.

Name of company: **Exner Process Equipment GmbH**  
 Address: Carl-Metz-Straße 26  
 D-76275 Ettlingen  
 Germany

  
 \_\_\_\_\_  
 Place

05.04.2019  
 \_\_\_\_\_  
 Date

  
 \_\_\_\_\_  
 Detlef Exner  
 General Manager

  
**EXNER**  
 Process Equipment GmbH  
 Carl-Metz-Straße 26  
 76275 Ettlingen / Germany  
 tpp-07243-045429-0 fax-99  
[www.ep-e.de](http://www.ep-e.de)

7 'o 'Contact:



[www.southforkinstruments.com](http://www.southforkinstruments.com)

Tel: 925 461 5059



Exner Process Equipment GmbH  
Carl-Metz-Str. 26  
D-76275 Ettlingen  
Germany

tel +49 (0)7243-94 54 29-0  
fax +49 (0)7243-94 54 29-99  
mail [info@e-p-e.de](mailto:info@e-p-e.de)

[www.e-p-e.com](http://www.e-p-e.com)